



Commercial Credit Group, Inc (Mark Wenzel)
525 N Tryon Street, Charlotte, NC 28202 USA
(704) 414-2456

VIN: 3AKJGLD52FSGL6241

2015 FREIGHTLINER CASCADIA

SPECIFICATIONS	
MILEAGE	682,046 / 13,947 (ECM)
ENGINE HOURS	15,931
ENGINE	DETROIT DD15 455 HP
ENG BRAKE	YES
ENG SERIAL	471906S00293336
FUEL / TANKS	DIESEL - 2 ALUM 200 GAL TOTAL
EXHAUST	SINGLE
TRANSMISSION	DETROIT DT12 DA 1550 12 SPD AUTOSHIFT
DRIVE OPTS	POWER STEERING, OVERDRIVE, CRUISE
REAR END	DETROIT 3.08
AXLE TYPE	TANDEM - F 13,300 LB / R 40,000 LB
GVWR	53,300
FRAME	STEEL
SUSPENSION	AIR RIDE
WHEELBASE	228"
TIRE SIZE	275/80R22.5
WHEELS	F ALUMINUM / R ALUMINUM
WHEEL 5TH	AIR SLIDE
AIR COND	YES
AUX POWER UNIT?	YES
SLEEPER	72"
DUAL BUNK	YES
INTERIOR COLOR	GREY
RADIO	AM/FM / CD, OPERATIONAL
MIRRORS	DUAL POWER
HIGH BACK SEATS	DUAL
PASSENGER SEAT	STATIONARY
EXTERIOR COLOR	RED
BUMPER	PLASTIC
EXTERIOR OPTS	HEATED MIRRORS, FULL FAIRINGS



BRAKES	
LEFT FRONT	RIGHT FRONT
23	23
LEFT REAR 1	RIGHT REAR 1
21	24
LEFT REAR 2	RIGHT REAR 2
22	22
ADDITIONAL BRAKE DETAIL	
BRAKES HAVE WEAR.	

TIRES & WHEELS			
LEFT FRONT		RIGHT FRONT	
17 / 32 ALUMINUM		12 / 32 BRIDGESTONE ALUMINUM	
LEFT OUTER 1	LEFT INNER 1	RIGHT INNER 1	RIGHT OUTER 1
7 / 32 CONTINENTAL ALUMINUM	7 / 32 MICHELIN ALUMINUM	8 / 32 MICHELIN ALUMINUM	5 / 32 - ALUMINUM
LEFT OUTER 2	LEFT INNER 2	RIGHT INNER 2	RIGHT OUTER 2
10 / 32 FIRESTONE ALUMINUM	7 / 32 BRIDGESTONE ALUMINUM	7 / 32 BRIDGESTONE ALUMINUM	5 / 32 MICHELIN ALUMINUM
FRONT TIRES: 275/80R22.5		REAR TIRES: 275/80R22.5	

GENERAL OBSERVATIONS

OIL MILKY?	NO	LIGHTS WORK?	YES - ALL
OIL LEAKS?	YES	WIPERS WORK?	YES
WATER LEAKS?	NO	GAUGES WORK?	SEE NOTES
OIL IN COOLANT?	NO	AIR HORN WORKS?	SEE NOTES
CLUTCH PLAY?	NA	CITY HORN WORKS?	YES

STARTS?	SEE NOTES
DRIVES	SEE NOTES


ADDITIONAL OBSERVATIONS

ENGINE TURNED OVER BUT WOULD NOT START. APU NEEDS SERVICE. CHIPPED WINDSHIELD AT BOTTOM. UNIT TOWED TO FACILITY/ SEEPAGE AT BOTTOM OF BLOCK / OIL PAN.

WEAR & TEAR DETAIL	
DIAGNOSTICS	2 ACTIVE, 11 INACTIVE - SEE REPORT
INTERIOR	DIRTY
TIRES	7 BELOW 10/32'S
WHEELS	HUB COVER MISSING
FAIRINGS	MISSING RUBBER SKIRTS
BUMPER	SCUFFED / SCRATCHED
SLEEPER	CABINETS MISSING RIGHT SIDE, VARIOUS PARTS IN CAB
1/4 FENDERS	DAMAGED
MUD FLAP	LEFT SIDE MISSING

REPORT PHOTOS



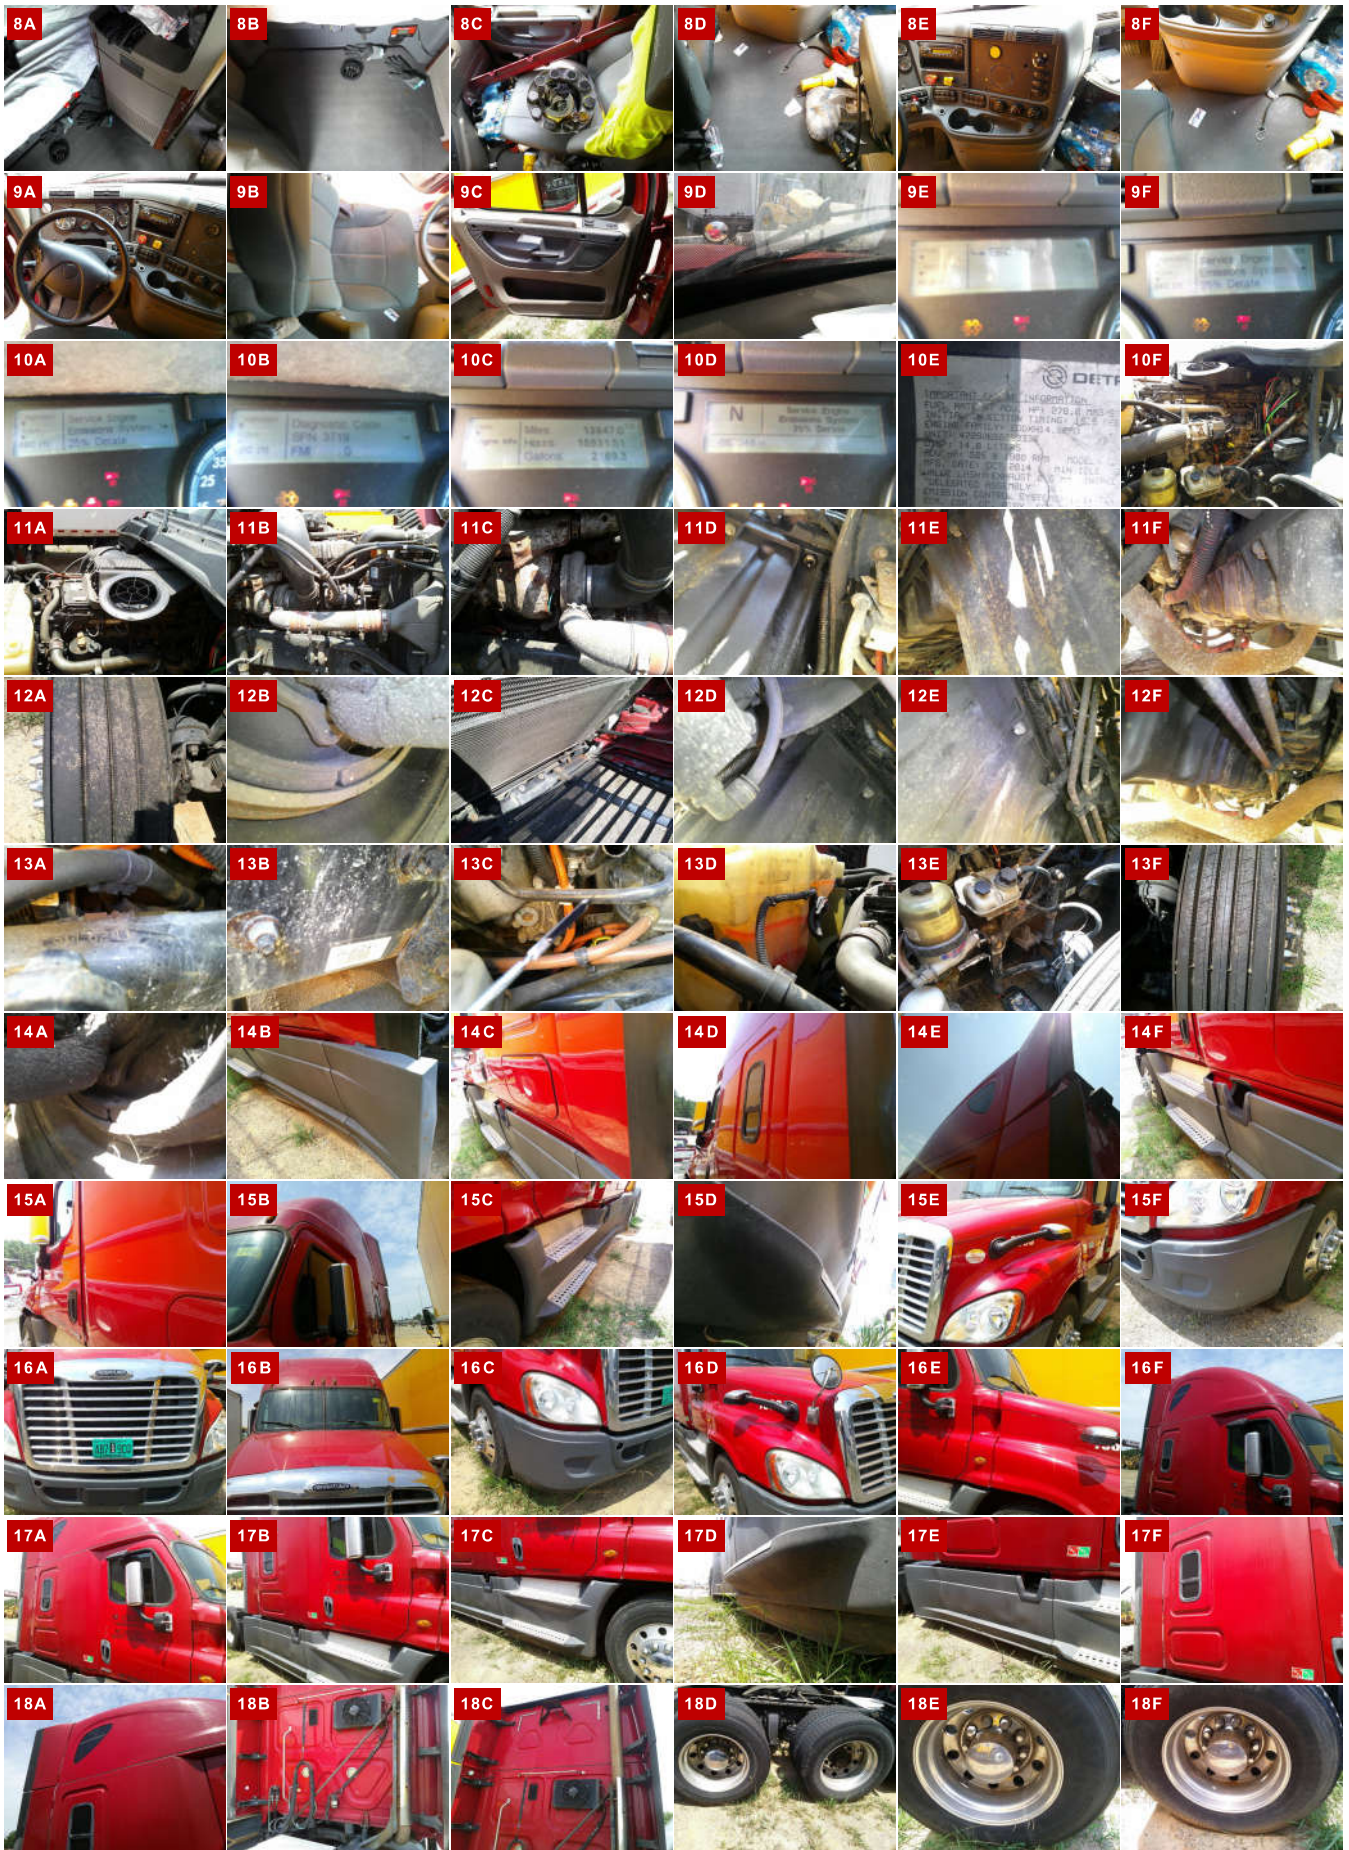

Condition report only. National Inspection Services does not guarantee mechanical reliability.

© National Inspection Services
101 W. Shrader St. Liberty, MO 64068
www.nationalinspect.com