

National Inspection Services

Report: 270434 07/25/2024

VIN: 3ALACWDT6HDJG9946

PO #: 15094

Commercial Credit Group, Inc (Mark Wenzel) 525 N Tryon Street, Charlotte, NC 28202 USA (704) 414-2456

2017 FREIGHTLINER M2

	SPECIFICATIONS
MILEAGE	270,492 / 270,492 (ECM)
ENGINE HOURS	6,867
ENGINE	CUMMINS ISB 6.7L 200 HP
ENG BRAKE	YES
ENG SERIAL	74062139
FUEL / TANKS	DIESEL - 1 ALUM 100 GAL TOTAL
TRANSMISSION	ALLISON 2100 RDS 6 SPD AUTO
DRIVE OPTS	POWER STEERING, OVERDRIVE, CRUISE
REAR END	DETROIT 5.22
AXLE TYPE	SINGLE - F 10,000 LB / R 21,000 LB
GVWR	26,000
FRAME	STEEL
SUSPENSION	AIR RIDE
WHEELBASE	270"
TIRE SIZE	275/80R22.5
WHEELS	F ALUMINUM / R STEEL
REAR D TYPE	ROLL-UP
R DOOR (IN X IN)	94W X 96H
LIFT GATE MAKE	THIESMAN
LIFT GATE CAPAC (LBS)	4000
INTERIOR H (IN)	102
EXTERIOR W (IN)	103
EXTERIOR L (FT)	26.0
AIR COND	YES, OPERATIONAL
INTERIOR COLOR	GREY
RADIO	AM/FM / CD, OPERATIONAL
MIRRORS	DUAL POWER
HIGH BACK SEATS	DUAL
PASSENGER SEAT	STATIONARY
EXTERIOR COLOR	WHITE
BUMPER	PAINTED
EXTERIOR OPTS	HEATED MIRRORS



BRAKES			
LEFT FRONT	RIGHT FRONT		
23	23		
LEFT REAR 1	RIGHT REAR 1		
18	17		

TIRES & WHEELS				
LEFT FRONT		RIGHT FRONT		
9 / 32 CONTINENTAL STEEL		10 / 32 YOKOHAMA STEEL		
LEFT OUTER 1	LEFT INNER 1	RIGHT INNER 1	RIGHT OUTER 1	
13 / 32 CONTINENTAL STEEL	12 / 32 CONTINENTAL STEEL	9 / 32 CONTINENTAL STEEL	9 / 32 CONTINENTAL STEEL	
FRONT TIRES: 275/80R22.5		REAR TIRES	: 275/80R22.5	

GENERAL	ORSE	:RVA I	IONS

OIL MILKY?	NO	LIGHTS WORK?	YES - ALL	
OIL LEAKS?	SEE NOTES	WIPERS WORK?	YES	
WATER LEAKS?	NO	GAUGES WORK?	YES - ALL	
OIL IN COOLANT?	NO	AIR HORN WORKS?	NA	
CLUTCH PLAY?	NA	CITY HORN WORKS?	YES	
STARTS?	YES			
DRIVES	YES	DIFEEL DARTION ATTEMPTED		DACC

ADDITIONAL OBSERVATIONS

ENGINE OIL LEAK FROM AROUND THE OIL PAN GASKET

WEAR & TEAR DETAIL

DIAGNOSTICS CHECK ENGINE AND STOP ENGINE LIGHTS ARE ILLUMINATED 2 ACTIVE /4 INACTIVE FAULTS DETECTED - (SEE ECM REPORT)

HOLE/DAMAGE FOR LH TOP FRONT CORNER OF BOX. BROKEN HANDLE FOR LIFT GATE. D/S LOWER FRONT CORNER HAS TAPE EXTERIOR BOX

COVERING HOLE. LINEAR SCRAPES DOWN THE P/S


SEATS BOTH ARE STAINED AND WORN

WINDSHIELD CRACKED ALONG THE BOTTOM

HEADLINER STAINED IN VARIOUS AREAS FALLING DOWN IN THE CORNERS

TIRES 3 TIRES UNDER 10/32



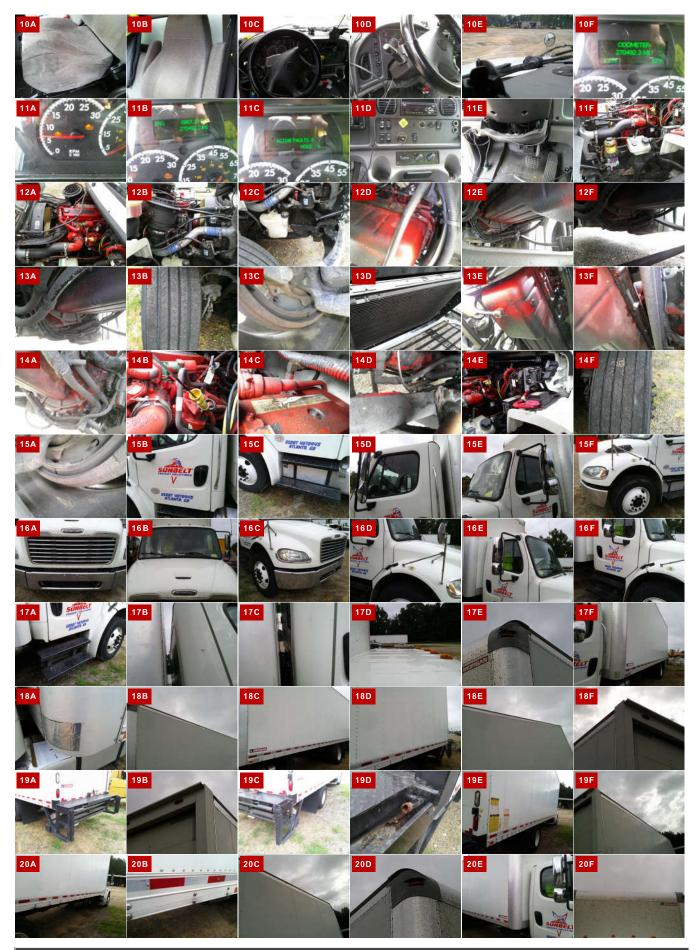

Condition report only. National Inspection Services does not guarantee mechanical reliability.

© National Inspection Services 101 W. Shrader St. Liberty, MO 64068 www.nationalinspect.com