

National Inspection Services

Report: 270084 07/26/2024

VIN: 3AKJGLDR4JSJK2691

PO #: 14662

Commercial Credit Group, Inc (Mark Wenzel) 525 N Tryon Street, Charlotte, NC 28202 USA (704) 414-2456

2018 FREIGHTLINER CASCADIA 125

	SPECIFICATIONS
MILEAGE	559,285 / 559,287 (ECM)
ENGINE HOURS	17,496
ENGINE	DETROIT DD15 14.8L 455 HP
ENG BRAKE	YES
ENG SERIAL	S0464935
FUEL / TANKS	DIESEL - 2 ALUM 200 GAL TOTAL
EXHAUST	VERTICAL
TRANSMISSION	DETROIT DT12 12 SPD AUTO
DRIVE OPTS	POWER STEERING, CRUISE
REAR END	DETROIT 2.41
AXLE TYPE	TANDEM - F 13,220 LB / R 40,000 LB
GVWR	53,220
FRAME	STEEL
SUSPENSION	AIR RIDE
WHEELBASE	228"
TIRE SIZE	11R22.5
WHEELS	ALUMINUM
WHEEL 5TH	AIR SLIDE
AIR COND	YES
INTERIOR COLOR	GRAY
MIRRORS	DUAL POWER
HIGH BACK SEATS	DUAL
PASSENGER SEAT	AIR RIDE
EXTERIOR COLOR	WHITE
BUMPER	PLASTIC
EXTERIOR OPTS	PARTIAL FAIRINGS





BRAKES		
LEFT FRONT	RIGHT FRONT	
DISC	DISC	
LEFT REAR 1	RIGHT REAR 1	
DISC	DISC	
LEFT REAR 2	RIGHT REAR 2	
DISC	DISC	

TIRES & WHEELS				
LEFT FRONT 8 / 32 GOODYEAR ALUMINUM		RIGHT FRONT 8 / 32 GOODYEAR ALUMINUM		
LEFT OUTER 1	LEFT INNER 1	RIGHT INNER 1	RIGHT OUTER 1	
15 / 32 CONTINENTAL ALUMINUM	21/32 CONTINENTAL ALUMINUM	8 / 32 CONTINENTAL ALUMINUM	12 / 32 CONTINENTAL ALUMINUM	
LEFT OUTER 2	LEFT INNER 2	RIGHT INNER 2	RIGHT OUTER 2	
12 / 32 CONTINENTAL ALUMINUM	7/32 CONTINENTAL ALUMINUM	15 / 32 CONTINENTAL ALUMINUM	9 / 32 CONTINENTAL ALUMINUM	
FRONT TIRES: 11R22.5		REAR TIRES : 11R22.5		

GENERAL OBSERVATIONS			
OIL MILKY?	NO	LIGHTS WORK?	YES - ALL
OIL LEAKS?	YES	WIPERS WORK?	YES
WATER LEAKS?	NO	GAUGES WORK?	SEE NOTES
OIL IN COOLANT?	NO	AIR HORN WORKS?	SEE NOTES
CLUTCH PLAY?	NA	CITY HORN WORKS?	YES
STARTS?	SEE NOTES		
DRIVES	SEE NOTES		

WEAR & TEAR DETAIL		
DIAGNOSTICS	LOW BATTERY POWER COULD NOT RUN OR CHECK ALL FUNCTIONS 9 ACTIVE / 7 INACTIVE FAULTS DETECTED - (SEE ECM REPORT)	
SEATS	BOTH ARE STAINED AND WORN	
HOOD	PAINT CHIPS AROUND HEADLIGHTS AND GRILLE	
ROOF	CRACKED ON D/S ABOVE WINDSHIELD	
FAIRING	D/S TANK FAIRING BROKEN AT THE REAR.	
BUMPER	BRACKETS ARE BENT AND BUMPER IS MISSING DAMAGED CENTER AND P/S MISSING	
STEERING WHEEL	SURFACES HAVE WEAR	
FENDER	P/S IS SCRAPED ABOVE THE WHEEL WELL	
INTERIOR CAB	FOOD AND DEBRIS ON THE FLOOR	
TIRES	5 TIRES BELOW 10/32.	

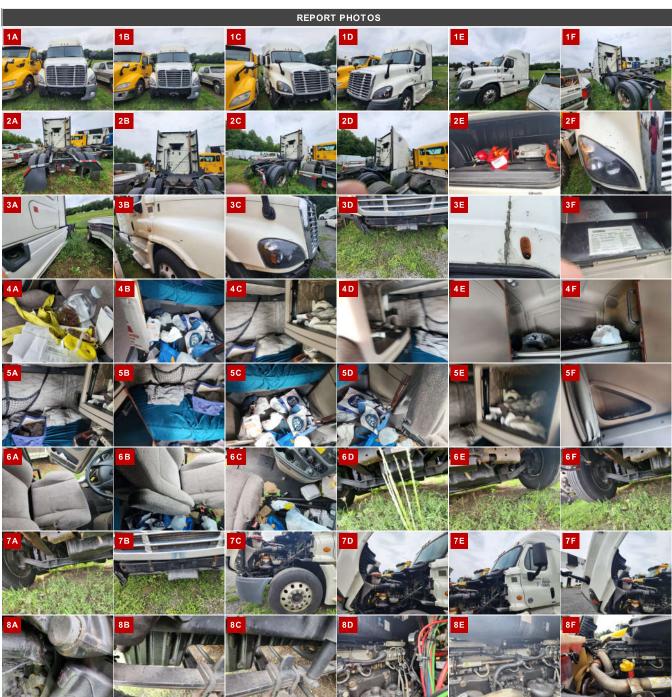

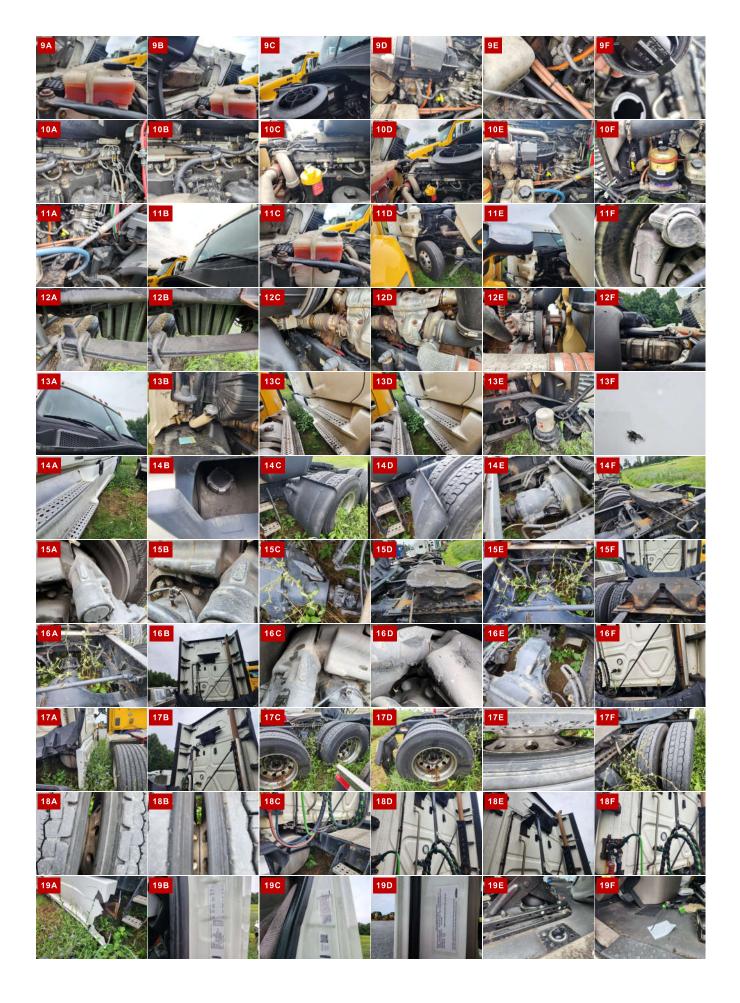



REPORT DOCUMENTS

Condition report only. National Inspection Services does not guarantee mechanical reliability.

© National Inspection Services 101 W. Shrader St. Liberty, MO 64068 www.nationalinspect.com