

National Inspection Services

Report: 272064 08/22/2024

VIN: 1XKYDP9X6HJ145781

PO #: 15118

Commercial Credit Group, Inc (Mark Wenzel) 525 N Tryon Street, Charlotte, NC 28202 USA (704) 414-2456

2017 KENWORTH T680

	SPECIFICATIONS	
ENGINE	PACCAR MX13 12.9L 455 HP	
ENG SERIAL	Y105725	
FUEL / TANKS	DIESEL - 2 ALUM 200 GAL TOTAL	
EXHAUST	SINGLE	
TRANSMISSION	EATON-FULLER FAO-16810S-EP3 10 SPD AUTO	
DRIVE OPTS	POWER STEERING, OVERDRIVE, CRUISE	
REAR END	MERITOR 2.64	
AXLE TYPE	TANDEM - F 12,350 LB / R 40,000 LB	
GVWR	52,350	
FRAME	STEEL	
SUSPENSION	AIR RIDE	
WHEELBASE	228"	
TIRE SIZE	295 75 22.5	
WHEELS	F ALUMINUM / R ALUMINUM	
WHEEL 5TH	AIR SLIDE	
AIR COND	YES	
SLEEPER	76"	
DUAL BUNK	YES	
INTERIOR COLOR	GREY	
RADIO	AM/FM / CD	
MIRRORS	DUAL POWER	
HIGH BACK SEATS	DUAL	
PASSENGER SEAT	AIR RIDE	
EXTERIOR COLOR	WHITE	
BUMPER	PAINTED	
EXTERIOR OPTS	HEATED MIRRORS, FULL FAIRINGS	



NOTES / DESCRIPTION

NO BATTERIES, UNABLE TO START AND TEST. ENGINE IS DISASSEMBLED, MANY PARTS ARE INSIDE ON CAB FLOOR.


BRAKES		
LEFT FRONT	RIGHT FRONT	
28	28	
LEFT REAR 1	RIGHT REAR 1	
24	24	
LEFT REAR 2	RIGHT REAR 2	
26	26	


	TIRES & WHEELS				
	LEFT FRONT		RIGHT FRONT		
	13/32 GOODYEAR STEEL		13 / 32 GOODYEAR STEEL		
П	LEFT OUTER 1	LEFT INNER 1	RIGHT INNER 1	RIGHT OUTER 1	
	13 / 32	=	13 / 32	16 / 32	
	STEEL	- -	STEEL	STEEL	
П	LEFT OUTER 2	LEFT INNER 2	RIGHT INNER 2	RIGHT OUTER 2	
	10 / 32 BRIDGESTONE STEEL	13 / 32 BRIDGESTONE STEEL	13 / 32 PIRELLI STEEL	10 / 32 PIRELLI STEEL	
	FRONT TIRES: 295 75 22.5		REAR TIRES	3 : 295 75 22.5	

GLNLKAL	OB.	3 LIV V	AII	0143

OIL MILKY?	YES	LIGHTS WORK?	SEE NOTES
OIL LEAKS?	YES	WIPERS WORK?	SEE NOTES
WATER LEAKS?	YES	GAUGES WORK?	SEE NOTES
OIL IN COOLANT?	SEE NOTES	AIR HORN WORKS?	SEE NOTES
CLUTCH PLAY?	NA	CITY HORN WORKS?	SEE NOTES
STARTS?	SEE NOTES		
DRIVES	SEE NOTES		

GENERAL NOTES	UNIT IS INOPERABLE INSTRUCTED TO INSPECT AS IS
ENGINE	ENGINE IS TORN APART MANY MISSING PARTS COMPLETELY INOPERABLE
INTERIOR	NO INTERIOR PICS CAB IS FULL OF MISSING ENGINE PARTS
HOOD	CRACKS ON BOTH SIDES
MIRRORS	HOOD MIRRORS ARE MISSING AND BOTH SIDE MIRRORS ARE MISSING COVERS.
GRILLE	GRILLE IS DAMAGED ON LEFT SIDE
FUEL TANK	PASSENGER SIDE FUEL TANK IS MISSING
FAIRINGS	DRIVER SIDE STEP FAIRING IS MISSING AND PASSENGER SIDE TANK FAIRING IS MISSING.
SUSPENSION	AIR RIDE BAGS ARE MISSING
TIRES	LEFT 1ST AXLE INNER TIRE AND WHEEL ARE MISSING

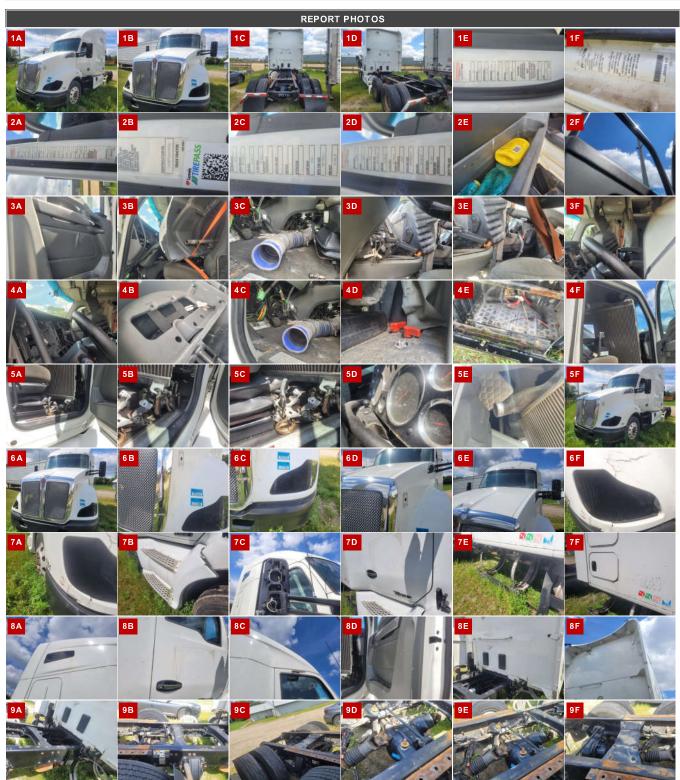

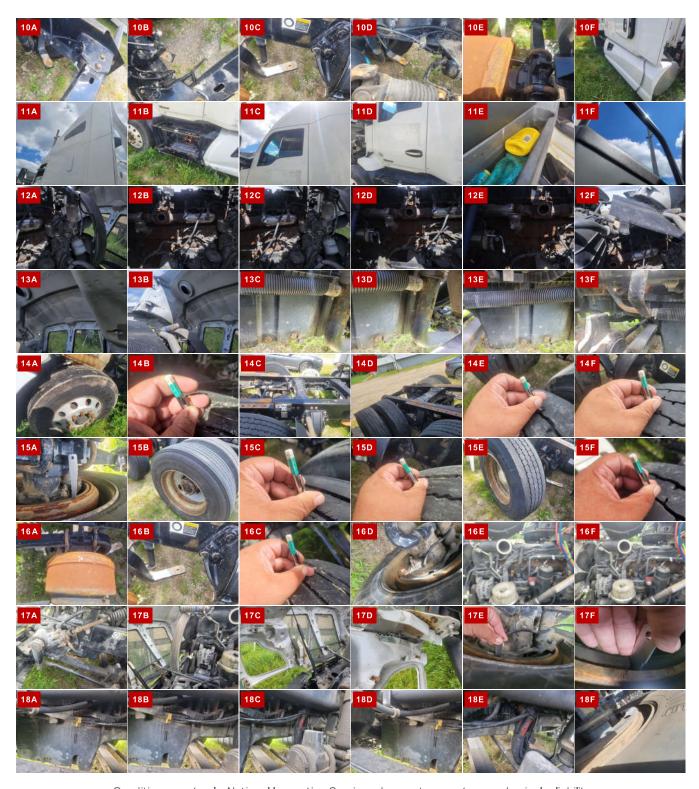

 $Condition\ report\ only.\ National\ Inspection\ Services\ does\ not\ guarantee\ mechanical\ reliability.$

© National Inspection Services 101 W. Shrader St. Liberty, MO 64068 www.nationalinspect.com