

National Inspection Services

Report: 273432 09/05/2024

VIN: 3HAMMMMN0JL543318

PO #: 14603

Commercial Credit Group, Inc (Mark Wenzel) 525 N Tryon Street, Charlotte, NC 28202 USA (704) 414-2456

2018 INTERNATIONAL 4300

	SPECIFICATIONS
MILEAGE	232,331 / 232,301 (ECM)
ENGINE HOURS	6,749
ENGINE	CUMMINS B6.7L 240 HP
ENG BRAKE	NO
ENG SERIAL	074116418
FUEL / TANKS	DIESEL - 1 ALUM 70 GAL TOTAL
TRANSMISSION	EATON EDCO-6F107A 7 SPD AUTO
DRIVE OPTS	POWER STEERING, OVERDRIVE, CRUISE
REAR END	MERITOR 5.29
AXLE TYPE	SINGLE - F 12,000 LB / R 21,000 LB
GVWR	33,000
FRAME	STEEL
SUSPENSION	AIR RIDE
WHEELBASE	271"
TIRE SIZE	11R22.5
WHEELS	F STEEL / R STEEL
LIFT GATE MAKE	WALTCO
LIFT GATE MODEL	WDV45G2
LIFT GATE CAPAC (LBS)	4500
INTERIOR H (IN)	103
EXTERIOR H (IN)	160
EXTERIOR W (IN)	102
EXTERIOR L (FT)	26.0
AIR COND	YES, OPERATIONAL
INTERIOR COLOR	GRAY
RADIO	AM/FM, OPERATIONAL
HIGH BACK SEATS	DUAL
PASSENGER SEAT	STATIONARY
EXTERIOR COLOR	YELLOW
BUMPER	PAINTED
EXTERIOR OPTS	HEATED MIRRORS
COLLISION AVOIDANCE?	NO



BRAKES		
LEFT FRONT	RIGHT FRONT	
COVERED	COVERED	
LEFT REAR 1	RIGHT REAR 1	
COVERED	COVERED	

TIRES & WHEELS				
LEFT FRONT		RIGHT FRONT		
13/32 BRIDGESTONE STEEL		14 / 32 BRIDGESTONE STEEL		
LEFT OUTER 1	LEFT INNER 1	RIGHT INNER 1	RIGHT OUTER 1	
19 / 32 BRIDGESTONE STEEL	23/32 BRIDGESTONE STEEL	21/32 CONTINENTAL STEEL	21/32 CONTINENTAL STEEL	
FRONT TIR	ES : 11R22.5	REAR TIRI	ES : 11R22.5	


		GENERAL OBSERVATIONS
OIL MILKY?	NO	LIGHTS WOR
OIL LEAKS?	NO	WIPERS WOF
WATER LEAKS?	NO	GAUGES WO
OIL IN COOLANT?	NO	AIR HORN WO
CLUTCH PLAY?	NA	CITY HORN V
STARTS?	YES	
DRIVES	YES	DIESEI DADI


LIGHTS WORK?	YES - ALL
WIPERS WORK?	YES
GAUGES WORK?	YES - ALL
AIR HORN WORKS?	YES
CITY HORN WORKS?	YES

ULCEI	DADTICIII ATE EII TED	DAGG

	. = 0	DIESEL PARTICULATE FILTER	FAJJ
--	-------	---------------------------	------

WEAR & TEAR DET AIL		
DIAGNOSTICS	1 ACTIVE / 3 INACTIVE FAULTS - SEE REPORT	
BUMPER	PAINT CHIPS / SCRATCHES	
DOORS	LS DOOR SEAL TORN	
LIFTGATE	BOTH SIDES POST'S SCRATCHED	
GEAR SELECTOR	RANGE PANEL CRACKED	
STEERING WHEEL	WORN AROUND THE EDGES / BUTTON LABELS WORN	

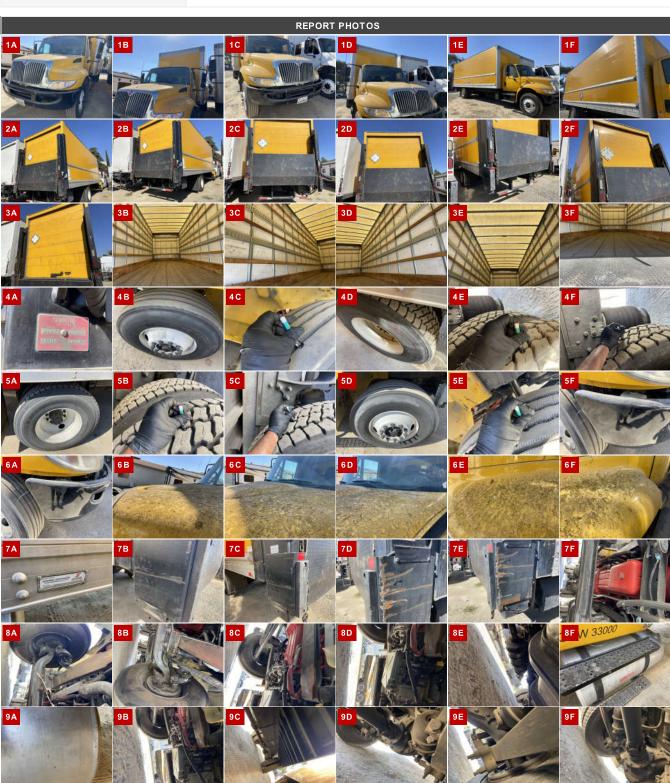

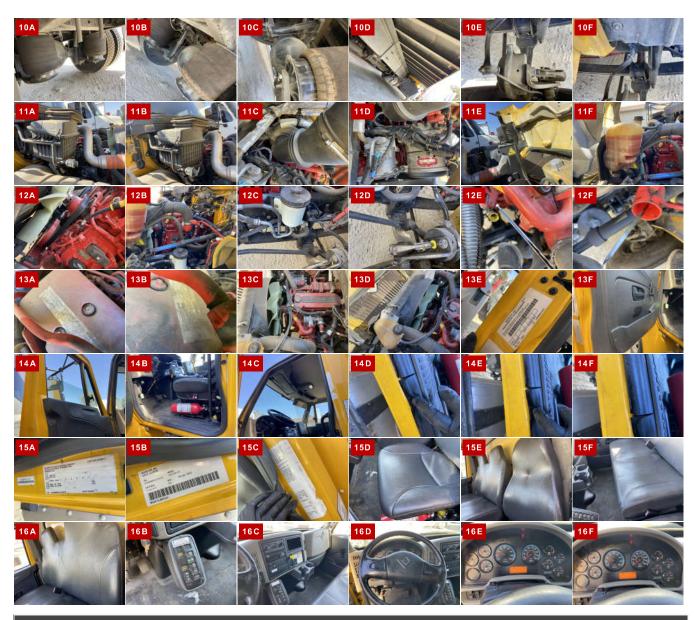

REPORT DOCUMENTS

Condition report only. National Inspection Services does not guarantee mechanical reliability.

© National Inspection Services 101 W. Shrader St. Liberty, MO 64068 www.nationalinspect.com