



Commercial Credit Group, Inc (Mark Wenzel)  
525 N Tryon Street, Charlotte, NC 28202 USA  
(704) 414-2456

VIN: 1FVACXDT6GHGW5481

2016 FREIGHTLINER M2 106

SPECIFICATIONS	
MILEAGE	266,596 / 266,596 (ECM)
ENGINE HOURS	8,778
ENGINE	CUMMINS ISB 6.7L 240 HP
ENG BRAKE	NO
ENG SERIAL	73793165
FUEL / TANKS	DIESEL - 1 ALUM 80 GAL TOTAL
TRANSMISSION	ALLISON 2500 RDS 6 SPD AUTO
DRIVE OPTS	POWER STEERING, OVERDRIVE, CRUISE
REAR END	DETROIT 5.56
AXLE TYPE	SINGLE - F 12,000 LB / R 21,000 LB
GVWR	33,000
FRAME	STEEL
SUSPENSION	AIR RIDE
WHEELBASE	270"
TIRE SIZE	11R22.5
WHEELS	F STEEL / R STEEL
REAR D TYPE	ROLL-UP
LIFT GATE CAPAC (LBS)	3000
EXTERIOR H (IN)	156
EXTERIOR W (IN)	102
EXTERIOR L (FT)	26.0
AIR COND	YES, NOT OPERATIONAL
INTERIOR COLOR	GRAY
RADIO	AM/FM / CD, OPERATIONAL
HIGH BACK SEATS	DRIVER SIDE ONLY
PASSENGER SEAT	STATIONARY
EXTERIOR COLOR	YELLOW
BUMPER	PAINTED
EXTERIOR OPTS	HEATED MIRRORS



BRAKES	
<b>LEFT FRONT</b>	<b>RIGHT FRONT</b>
COVERED	COVERED
<b>LEFT REAR 1</b>	<b>RIGHT REAR 1</b>
COVERED	COVERED

TIRES & WHEELS			
<b>LEFT FRONT</b>		<b>RIGHT FRONT</b>	
15 / 32 BRIDGESTONE STEEL		13 / 32 BRIDGESTONE STEEL	
<b>LEFT OUTER 1</b>	<b>LEFT INNER 1</b>	<b>RIGHT INNER 1</b>	<b>RIGHT OUTER 1</b>
12 / 32 CONTINENTAL STEEL	12 / 32 CONTINENTAL STEEL	5 / 32 CONTINENTAL STEEL	5 / 32 CONTINENTAL STEEL
FRONT TIRES: 11R22.5		REAR TIRES: 11R22.5	

GENERAL OBSERVATIONS


OIL MILKY?	NO	LIGHTS WORK?	YES - ALL
OIL LEAKS?	NO	WIPERS WORK?	YES
WATER LEAKS?	NO	GAUGES WORK?	YES - ALL
OIL IN COOLANT?	NO	AIR HORN WORKS?	YES
CLUTCH PLAY?	NA	CITY HORN WORKS?	YES
STARTS?	YES		
DRIVES	YES	DIESEL PARTICULATE FILTER	PASS

WEAR & TEAR DETAIL

DIAGNOSTIC ... COLLECTIVE FAIL TO REPORT (SEE FORM REPORT)

DIAGNOSTICS	22 INACTIVE FAULTS DETECTED (SEE ECM REPORT)
CAB STEPS	PAINT WORN AND RUST FORMING AT BOTH SIDES
REAR DOOR	DOOR JAMMED, UNABLE TO OPEN
EXTERIOR	ALL SIDES OF BOX AND BOTH SIDES OF CAB COVERED W/ GRAFFITI
HEADLINER	STARTING TO COME LOOSE IN SPOTS
STEERING WHEEL	WORN AND DAMAGED, COVER TORN
TIRES	2 MEASURE BELOW 10/32

REPORT PHOTOS

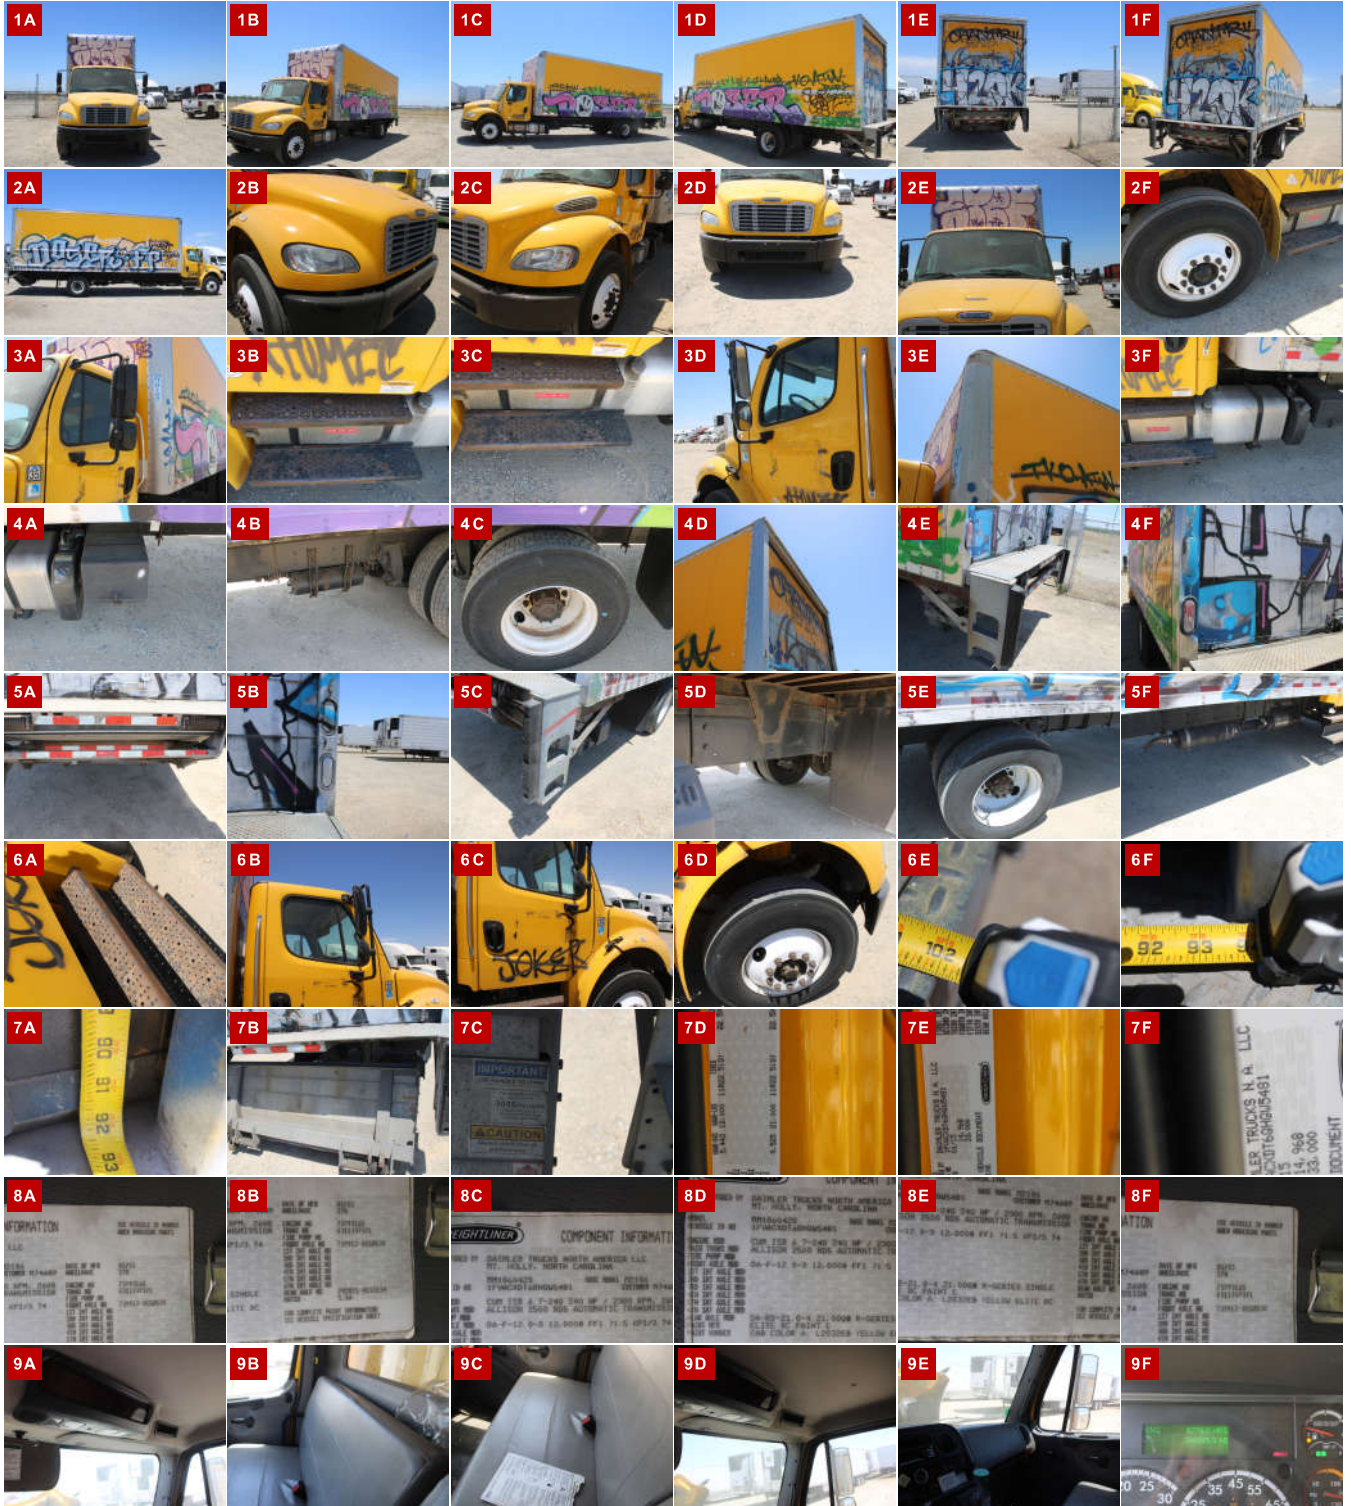





REPORT DOCUMENTS

Condition report only. National Inspection Services does not guarantee mechanical reliability.

© National Inspection Services  
101 W. Shrader St. Liberty, MO 64068  
[www.nationalinspect.com](http://www.nationalinspect.com)