



Commercial Credit Group, Inc (Mark Wenzel)
525 N T ryon Street, Charlotte, NC 28202 USA
(704) 414-2456

VIN: 3ALACWFB6LDLX6418

2020 FREIGHTLINER M106

SPECIFICATIONS	
MILEAGE	272,342 / 272,343 (ECM)
ENGINE HOURS	9,444
ENGINE	DETROIT DD5.1L 4 CYL 240 HP
ENG BRAKE	YES
FUEL / TANKS	DIESEL - 2 STEEL 100 GAL TOTAL
TRANSMISSION	ALLISON 2200 HS AUTO
DRIVE OPTS	POWER STEERING, CRUISE
REAR END	DETROIT 6.14
AXLE TYPE	SINGLE - F 10,000 LB / R 16,000 LB
GVWR	26,000
FRAME	STEEL
SUSPENSION	AIR RIDE
WHEELBASE	252"
TIRE SIZE	11R22.5
WHEELS	F STEEL / R STEEL
REAR D TYPE	ROLL-UP
R DOOR (IN X IN)	94W X 96H
LIFT GATE MAKE	DHOLLANDIA
LIFT GATE CAPAC (LBS)	3300
INTERIOR H (IN)	102
EXTERIOR H (IN)	157
EXTERIOR W (IN)	102
EXTERIOR L (FT)	26.0
AIR COND	YES, OPERATIONAL
INTERIOR COLOR	GREY
HIGH BACK SEATS	DRIVER SIDE ONLY
PASSENGER SEAT	STATIONARY
EXTERIOR COLOR	WHITE
BUMPER	PAINTED
EXTERIOR OPTS	HEATED MIRRORS



BRAKES	
LEFT FRONT	RIGHT FRONT
28	26
LEFT REAR 1	RIGHT REAR 1
18	18

TIRES & WHEELS			
LEFT FRONT		RIGHT FRONT	
16 / 32 STEEL		16 / 32 STEEL	
LEFT OUTER 1	LEFT INNER 1	RIGHT INNER 1	RIGHT OUTER 1
7 / 32 MICHELIN STEEL	9 / 32 MICHELIN STEEL	12 / 32 HANKOOK STEEL	19 / 32 HANKOOK STEEL
FRONT TIRES: 11R22.5		REAR TIRES: 11R22.5	

ADDITIONAL TIRE DETAIL
BLACKHAWK STEER TIRES

GENERAL OBSERVATIONS

OIL MILKY?	NO	LIGHTS WORK?	YES - ALL
OIL LEAKS?	YES	WIPERS WORK?	YES
WATER LEAKS?	NO	GAUGES WORK?	YES - ALL
OIL IN COOLANT ?	NO	AIR HORN WORKS?	YES
CLUTCH PLAY?	NA	CITY HORN WORKS?	YES
STARTS?	YES		

DRIVES	YES	DIESEL PARTICULATE FILTER	PASS
--------	-----	---------------------------	------


ADDITIONAL OBSERVATIONS

REAR DIFFERENTIAL IS LEAKING

WEAR & TEAR DETAIL

DIAGNOSTICS	ABS, STOP ENGINE, CHECK ENGINE LIGHT ILLUMINATED. 5 ACTIVE / 17 INACTIVE FAULTS DETECTED - (SEE ECM REPORT)
HOOD	LATCH MISSING ON PASSENGER SIDE
BUMPER	HAS DENT ON DRIVER SIDE
EXTERIOR BOX	MULTIPLE SCRATCHES AROUND BOX HAS SMALL DENT ON PASSENGER SIDE
PAINT	CHIPPED ON REAR DOOR
MIRROR	SIDE MIRROR SCRATCHED ON BOTH SIDES
HEADLINER	STAINED IN VARIOUS AREAS

REPORT PHOTOS

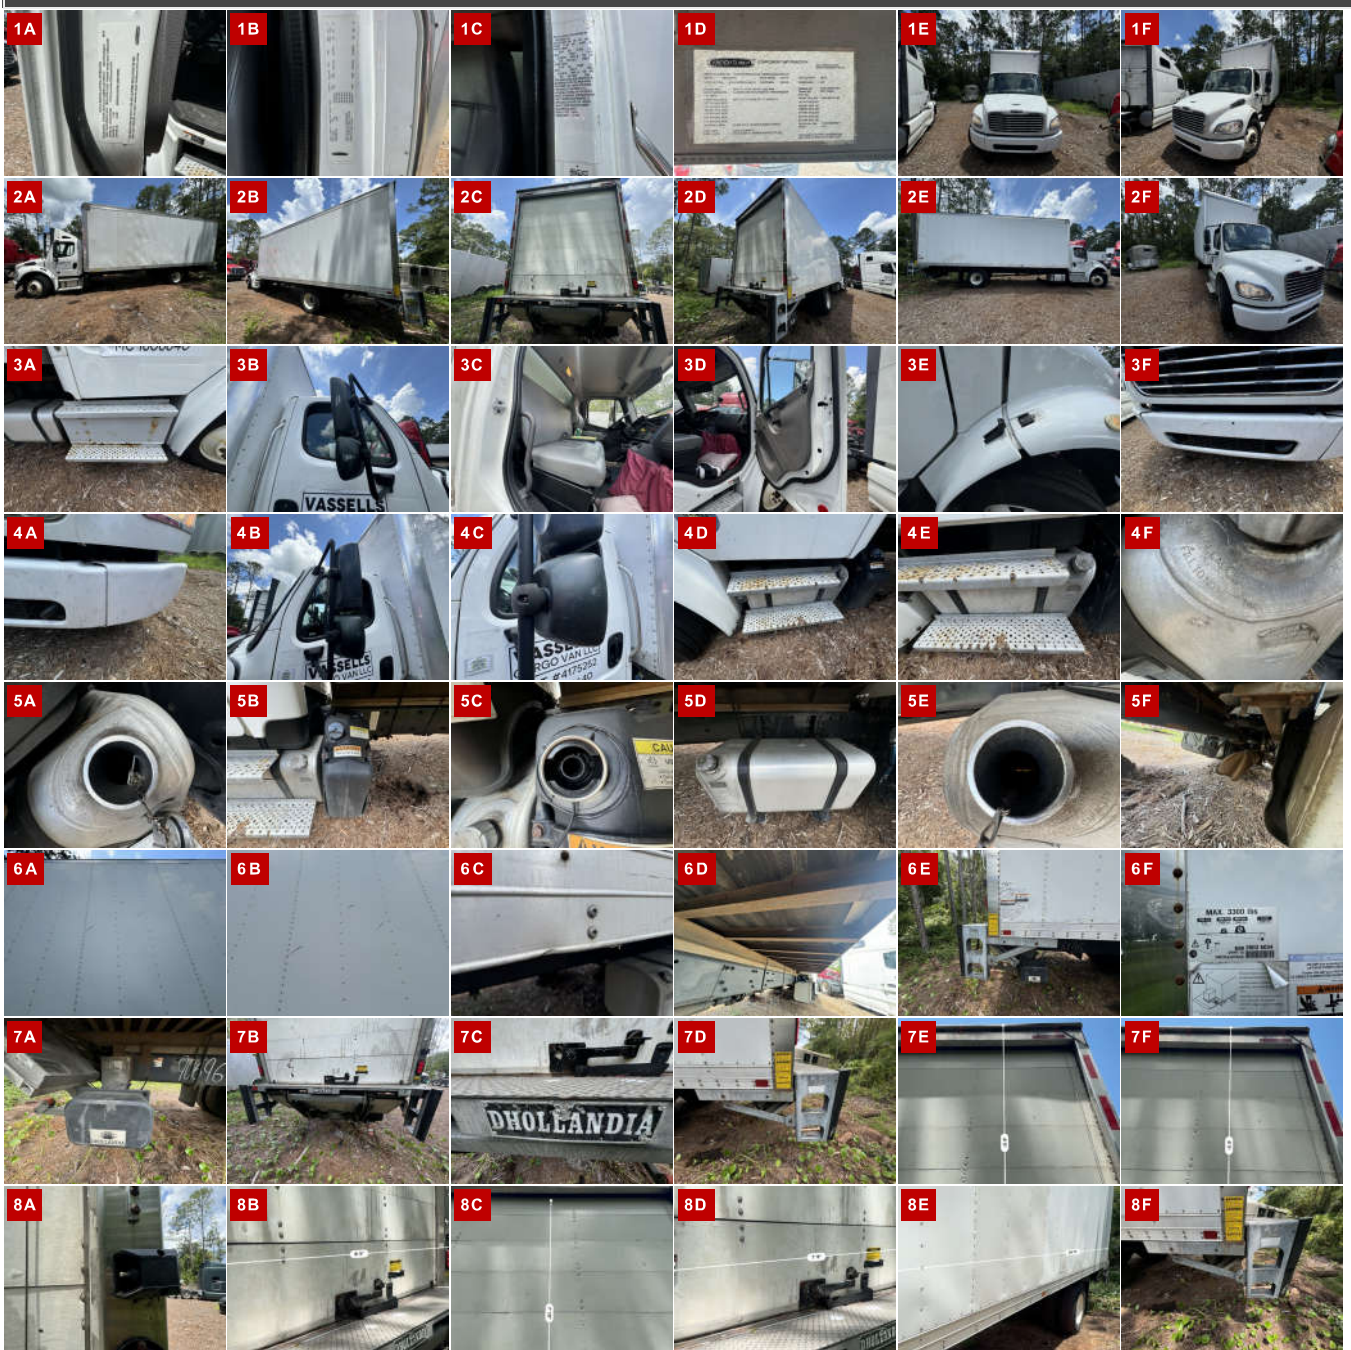



Condition report only. National Inspection Services does not guarantee mechanical reliability.

© National Inspection Services
101 W. Shrader St. Liberty, MO 64068
www.nationalinspect.com