



**Commercial Credit Group, Inc (Mark Wenzel)**  
525 N Tryon Street, Charlotte, NC 28202 USA  
(704) 414-2456

VIN: 3AKJGLDR9JSHR1283  
PO #: 15089

**2018 FREIGHTLINER CASCADIA 125**

SPECIFICATIONS	
MILEAGE	180,763 / 97,256 (ECM)
ENGINE HOURS	22,345
ENGINE	DETROIT DD 15 14.8 L 455 HP
ENG BRAKE	YES
ENG SERIAL	472910S0486725
FUEL / TANKS	DIESEL - 2 ALUM 200 GAL TOTAL
EXHAUST	HORIZONTAL
TRANSMISSION	DETROIT DT12 OA-1650 HD 12 SPD AUTO
DRIVE OPTS	POWER STEERING, OVERDRIVE, CRUISE
REAR END	DETROIT 2.85
AXLE TYPE	TANDEM - F 12,350 LB / R 40,000 LB
GVWR	52,350
FRAME	STEEL
SUSPENSION	AIR RIDE
WHEELBASE	228"
TIRE SIZE	295/75R22.5
WHEELS	ALUMINUM
WHEEL 5TH	AIR SLIDE
AIR COND	YES, OPERATIONAL
DUAL BUNK	YES
INTERIOR COLOR	GRAY
RADIO	AM/FM
MIRRORS	DUAL POWER
HIGH BACK SEATS	DUAL
PASSENGER SEAT	AIR RIDE
EXTERIOR COLOR	WHITE
BUMPER	PLASTIC
EXTERIOR OPTS	HEATED MIRRORS, FULL FAIRINGS



BRAKES	
<b>LEFT FRONT</b>	<b>RIGHT FRONT</b>
21	22
<b>LEFT REAR 1</b>	<b>RIGHT REAR 1</b>
21	21
<b>LEFT REAR 2</b>	<b>RIGHT REAR 2</b>
20	20

TIRES & WHEELS			
<b>LEFT FRONT</b>		<b>RIGHT FRONT</b>	
14 / 32 ALUMINUM		14 / 32 ALUMINUM	
<b>LEFT OUTER 1</b>	<b>LEFT INNER 1</b>	<b>RIGHT INNER 1</b>	<b>RIGHT OUTER 1</b>
6 / 32 - ALUMINUM	8 / 32 - STEEL	18 / 32 - STEEL	16 / 32 - ALUMINUM
<b>LEFT OUTER 2</b>	<b>LEFT INNER 2</b>	<b>RIGHT INNER 2</b>	<b>RIGHT OUTER 2</b>
16 / 32 - ALUMINUM	13 / 32 - STEEL	15 / 32 - STEEL	17 / 32 - ALUMINUM
<b>FRONT TIRES: 295/75R22.5</b>		<b>REAR TIRES: 295/75R22.5</b>	

**GENERAL OBSERVATIONS**

<b>OIL MILKY?</b>	NO	<b>LIGHTS WORK?</b>	YES - ALL
<b>OIL LEAKS?</b>	NO	<b>WIPERS WORK?</b>	YES
<b>WATER LEAKS?</b>	NO	<b>GAUGES WORK?</b>	YES - ALL
<b>OIL IN COOLANT?</b>	NO	<b>AIR HORN WORKS?</b>	YES
<b>CLUTCH PLAY?</b>	NA	<b>CITY HORN WORKS?</b>	YES
<b>STARTS?</b>	YES		
<b>DRIVES</b>	SEE NOTES	<b>DIESEL PARTICULATE FILTER</b>	<b>PASS</b>


ADDITIONAL OBSERVATIONS

DRIVE SHAFT DISCONNECTED

WEAR & TEAR DETAIL

DIAGNOSTIC	2 ACTIVE FAULTS / 27 INACTIVE FAULTS FOUND - (SEE ECM REPORT)
HOOD	FENDER BOTH SIDES HAS PAINT CHIPS AROUND HEADLIGHTS
FAIRINGS	STEP AND TANK FAIRINGS LS DAMAGED
CAB EXTERIOR	CAB BODY ALL SIDES HAVE RESIDUAL GRAPHICS ADHESIVE NEEDS REMOVAL
SEATS	UPHOLSTERY STAINED AND WORN.
TIRES	2 TIRES WORN BELOW 10/32.


REPORT PHOTOS

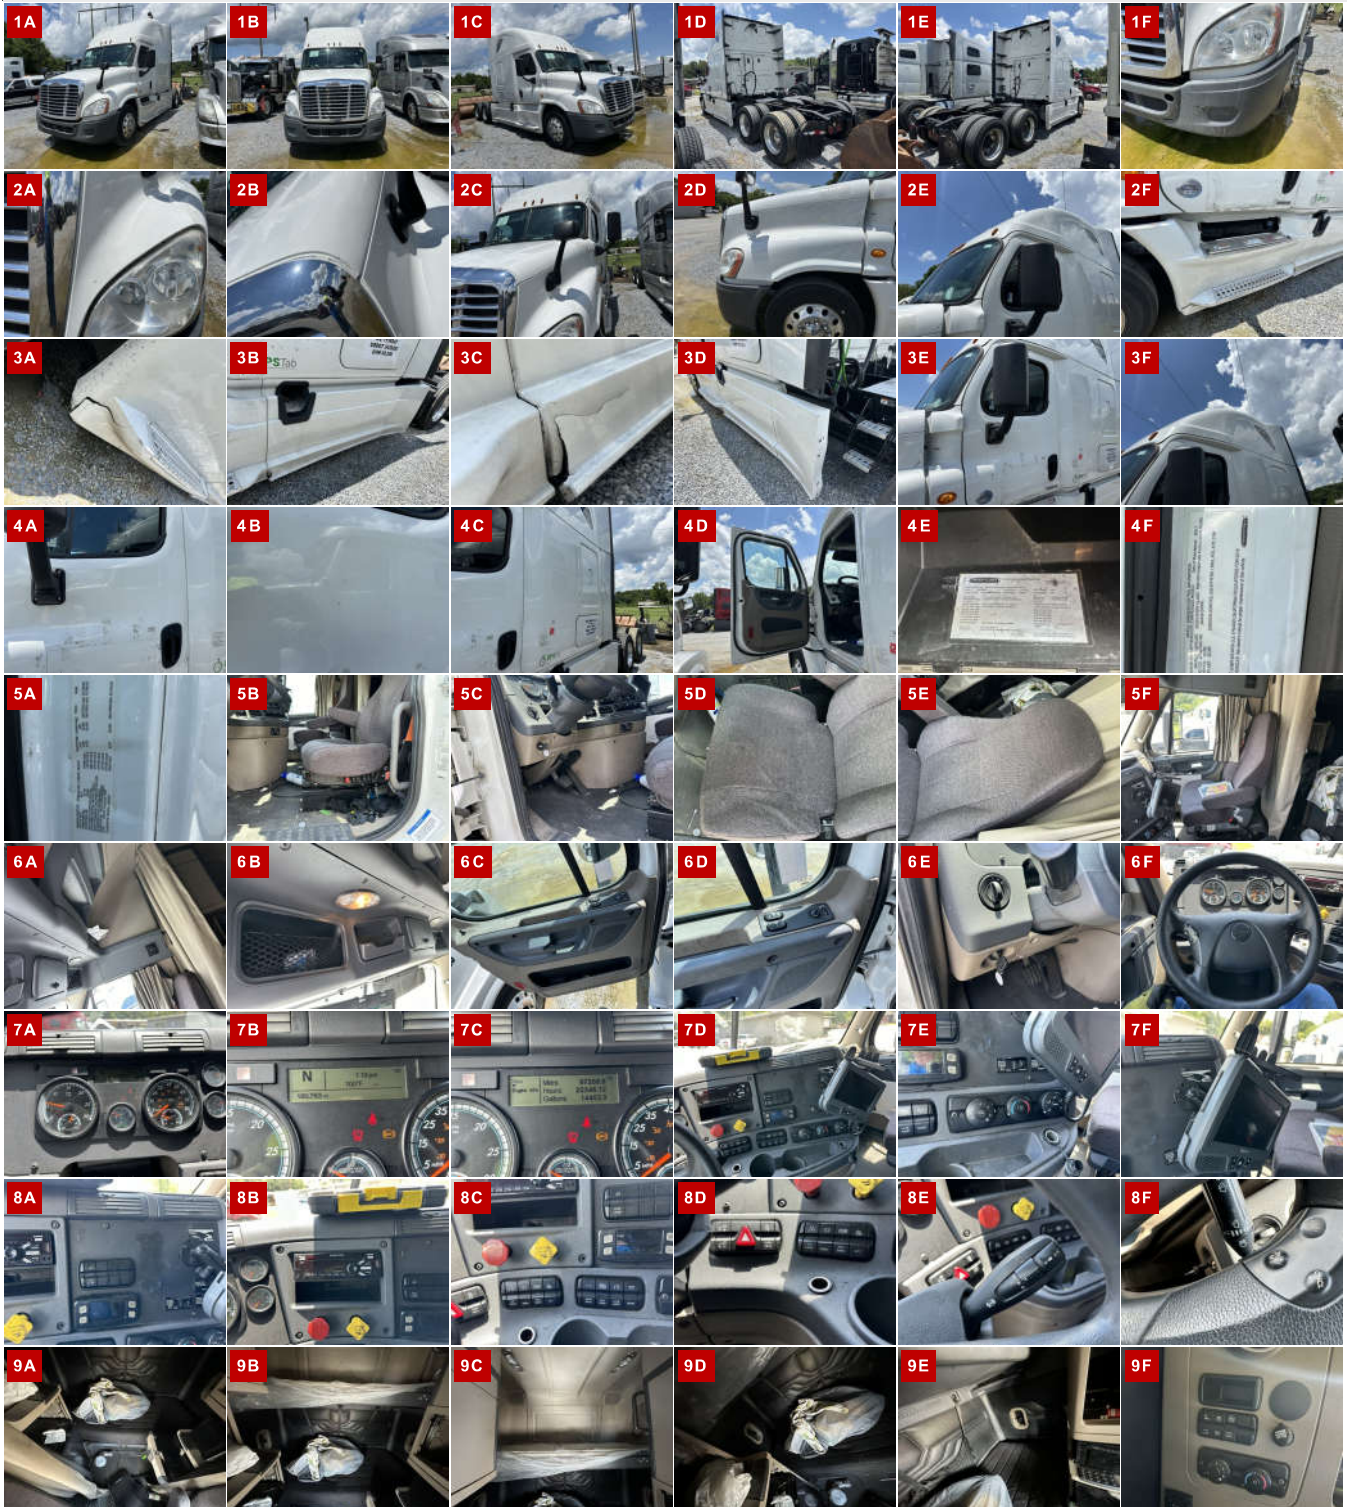







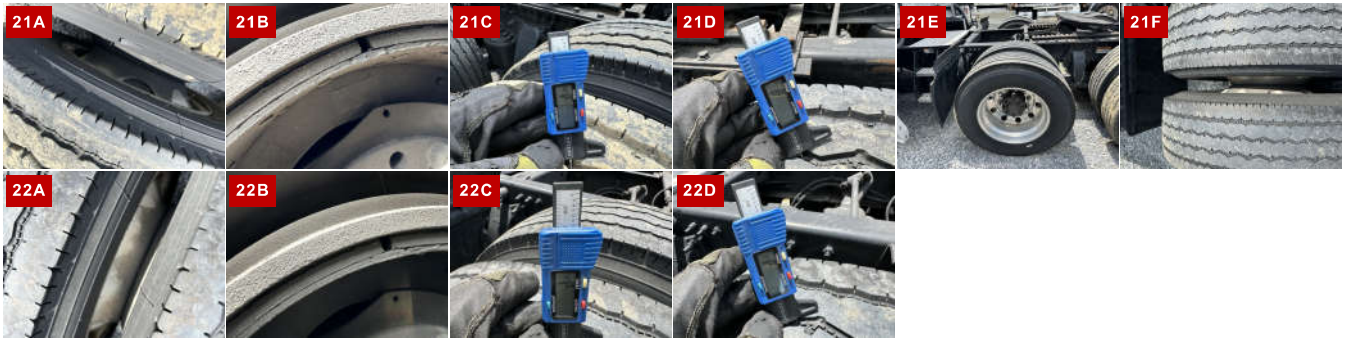

REPORT DOCUMENTS

Condition report only. National Inspection Services does not guarantee mechanical reliability.

© National Inspection Services  
101 W. Shrader St. Liberty, MO 64068  
[www.nationalinspect.com](http://www.nationalinspect.com)