

National Inspection Services

Report: 271711 08/15/2024

VIN: 3AKJGLDR7JSJX4946

PO #: 15113

Commercial Credit Group, Inc (Mark Wenzel) 525 N Tryon Street, Charlotte, NC 28202 USA (704) 414-2456

2018 FREIGHTLINER CASCADIA 125

	SPECIFICATIONS	
MILEAGE	568,968	
ENGINE	DETROIT DD15 14.8L 455 HP	
ENG BRAKE	YES	
ENG SERIAL	472910S0522801	
FUEL / TANKS	DIESEL - 2 ALUM 150 GAL TOTAL	
EXHAUST	SINGLE	
TRANSMISSION	EATON-FULLER FRO-16210C 10 SPD MANUAL	
DRIVE OPTS	POWER STEERING, OVERDRIVE, CRUISE	
REAR END	MERITOR 3.25	
AXLE TYPE	TANDEM - F 12,000 LB / R 40,000 LB	
GVWR	52,000	
FRAME	STEEL	
SUSPENSION	AIR RIDE	
WHEELBASE	257"	
TIRE SIZE	295/75	
WHEELS	F ALUMINUM / R ALUMINUM	
WHEEL 5TH	STATIONARY	
AIR COND	YES	
SLEEPER	48"	
INTERIOR COLOR	GREY	
RADIO	AM/FM	
MIRRORS	DUAL POWER	
HIGH BACK SEATS	DUAL	
PASSENGER SEAT	AIR RIDE	
EXTERIOR COLOR	WHITE	
BUMPER	CHROME	
EXTERIOR OPTS	HEATED MIRRORS	



NOTES / DESCRIPTION

COULD NOT CRANK, WASN'T ABLE TO JUMP. THEY TOWED IT OUT SO I COULD TAKE BETTER PICTURES

BRAKES		
LEFT FRONT	RIGHT FRONT	
26	26	
LEFT REAR 1	RIGHT REAR 1	
18	18	
LEFT REAR 2	RIGHT REAR 2	
28	28	


TIRES & WHEELS				
LEFT FRONT		RIGHT FRONT		
10 / 32 UNIROYAL ALUMINUM		11/32 UNIROYAL ALUMINUM		
LEFT OUTER 1	LEFT INNER 1	RIGHT INNER 1	RIGHT OUTER 1	
BRIDGESTONE ALUMINUM	BRIDGESTONE ALUMINUM	1/32 GOODYEAR ALUMINUM	3/32 GOODYEAR ALUMINUM	
LEFT OUTER 2	LEFT INNER 2	RIGHT INNER 2	RIGHT OUTER 2	
16 / 32	13 / 32	14 / 32	17 / 32	
UNIROYAL ALUMINUM	UNIROYAL ALUMINUM	UNIROYAL ALUMINUM	UNIROYAL ALUMINUM	
FRONT TIE	RES: 295/75	REAR TIR	ES : 295/75	

GENERAL OBSERVATIONS

OIL MILKY?	NO
OIL LEAKS?	YES
WATER LEAKS?	NO
OIL IN COOLANT?	NO
CLUTCH PLAY?	NA
STARTS?	SEE NOTES
DRIVES	SEE NOTES
CLUTCH PLAY? STARTS?	NA SEE NOTES

LIGHTS WORK?	YES - ALL
WIPERS WORK?	YES
GAUGES WORK?	SEE NOTES
AIR HORN WORKS?	YES
CITY HORN WORKS?	YES

WEAR & TEAR DETAIL		
DIAGNOSTIC	21 INACTIVE FAULTS FOUND - (SEE ECM REPORT)	
PAINT	CHIPPED ON BUMPER ON DRIVER SIDE	
FRAME	RUSTED IN REAR	
MUD FLAP	MISSING ON PASSENGER SIDE	
MIRROR	PASSENGER SIDE MIRROR SCRATCHED	
TIRES	4 TIRES WORN BELOW 10/32.	

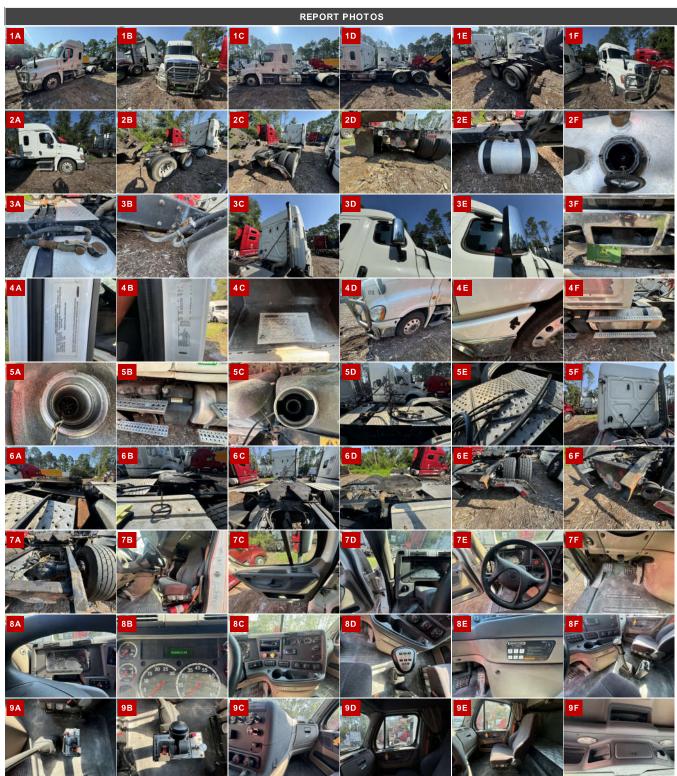



Condition report only. National Inspection Services does not guarantee mechanical reliability.

© National Inspection Services 101 W. Shrader St. Liberty, MO 64068 www.nationalinspect.com