



Commercial Credit Group, Inc (Mark Wenzel)
525 N Tryon Street, Charlotte, NC 28202 USA
(704) 414-2456

VIN: 5PVNJ8JV9G4S60363

2016 HINO 268

SPECIFICATIONS	
MILEAGE	264,883 / 264,994 (ECM)
ENGINE HOURS	9,864
ENGINE	HINO J05E-TP-210 210 HP
ENG BRAKE	YES
FUEL / TANKS	DIESEL - 1 STEEL 95 GAL TOTAL
TRANSMISSION	ALLISON 2500RDS 6 SPD AUTO
DRIVE OPTS	POWER STEERING, OVERDRIVE, CRUISE
REAR END	MERITOR 5.12
AXLE TYPE	SINGLE - F 10,000 LB / R 19,000 LB
GVWR	25,950
FRAME	STEEL
SUSPENSION	AIR RIDE
WHEELBASE	270"
TIRE SIZE	11R22.5
WHEELS	F ALUMINUM / R ALUMINUM
REAR D TYPE	ROLL-UP
R DOOR (IN X IN)	94W X 96H
LIFT GATE MAKE	WALTCO
LIFT GATE MODEL	HLE30
LIFT GATE CAPAC (LBS)	3000
INTERIOR H (IN)	97
EXTERIOR W (IN)	102
EXTERIOR L (FT)	26.0
AIR COND	YES, OPERATIONAL
INTERIOR COLOR	GRAY BLACK
RADIO	AM/FM / CD, OPERATIONAL
HIGH BACK SEATS	DUAL
PASSENGER SEAT	STATIONARY
EXTERIOR COLOR	YELLOW
BUMPER	PAINTED
EXTERIOR OPTS	HEATED MIRRORS



BRAKES	
LEFT FRONT	RIGHT FRONT
COVERED	COVERED
LEFT REAR 1	RIGHT REAR 1
COVERED	COVERED

TIRES & WHEELS			
LEFT FRONT		RIGHT FRONT	
6 / 32 GOODYEAR ALUMINUM		9 / 32 BRIDGESTONE ALUMINUM	
LEFT OUTER 1	LEFT INNER 1	RIGHT INNER 1	RIGHT OUTER 1
9 / 32 CONTINENTAL ALUMINUM	8 / 32 CONTINENTAL ALUMINUM	10 / 32 BRIDGESTONE ALUMINUM	13 / 32 BRIDGESTONE ALUMINUM
FRONT TIRES: 11R22.5		REAR TIRES: 11R22.5	

GENERAL OBSERVATIONS


OIL MILKY?	NO	LIGHTS WORK?	YES - ALL
OIL LEAKS?	NO	WIPERS WORK?	YES
WATER LEAKS?	NO	GAUGES WORK?	YES - ALL
OIL IN COOLANT?	NO	AIR HORN WORKS?	YES
CLUTCH PLAY?	NA	CITY HORN WORKS?	YES
STARTS?	YES		
DRIVES	YES	DIESEL PARTICULATE FILTER	PASS

WEAR & TEAR DETAIL

DIAGNOSTICS	NO ACTIVE WARNING INDICATORS
BODY	SCRATCHES AND SMALL DENTS ALONG BODY
REAR DOOR	DOOR ROLLER OUT OF TRACK. MULTIPLE HINGES WORN AND NEED ATTENTION
LIFTGATE	LIFTGATE PLATFORM MISSING SECTION IN MIDDLE.
SEATS	PASSENGER SEAT HAS SMALL TEAR
HEADLINER	STAINED IN VARIOUS AREAS
WINDSHEILD	WINDSHEILD CRACKED
TIRES	4 ARE LESS THAN 10/32

REPORT PHOTOS



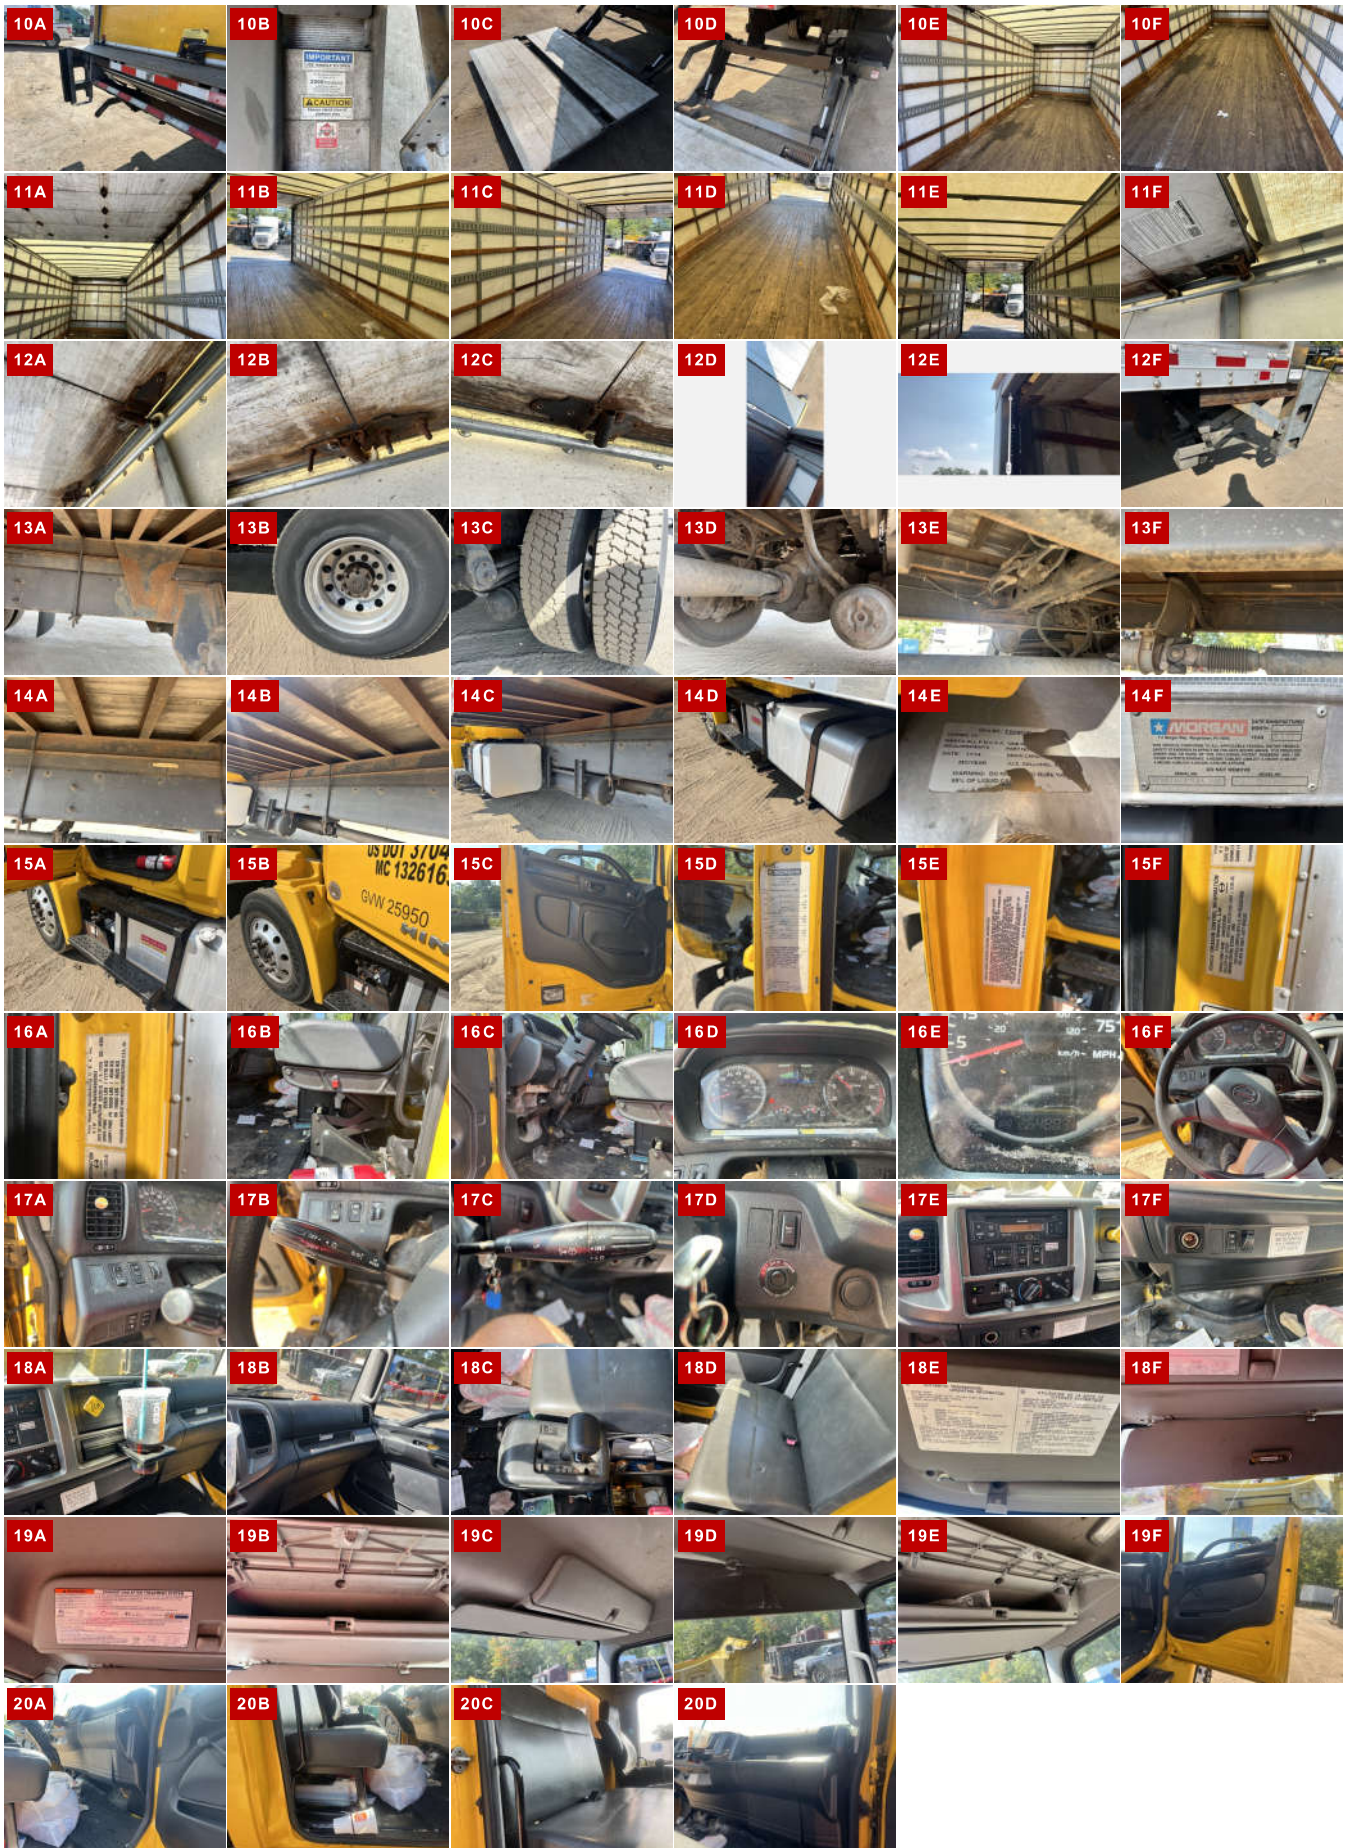

Condition report only. National Inspection Services does not guarantee mechanical reliability.

101 W. Shrader St. Liberty, MO 64068
www.nationalinspect.com